
City of Baltimore Wet Smoke and Dyed	Page 1 of 2	
Sewershed: Gwynns Falls	Company: Savin	Date: 4/22/2009
Test to be performed:  Smoke Dyed Water X	Ground Condition:  Dry ✓ Damp ☐ Wet ☐	Supervisor: JAW
Manhole_ID: S07MM1036MH	Test ID: <u>D1032-034012</u>	Notification Made: NA (Residents, Fire, 311)

Field Sketch: Show all manholes with Numbers, Blower Placement Locations, Sandbag or Isolation Locations, Street Names, Building Addresses and Locations, Defect Locations and Photo Numbers.

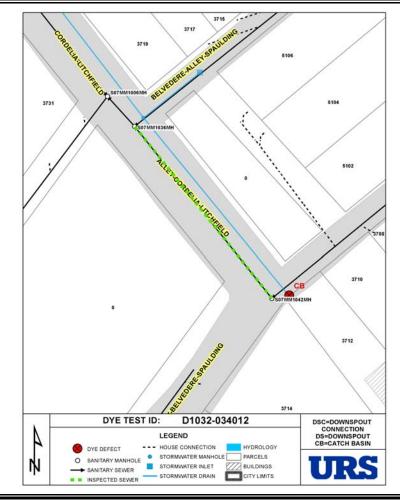

Defect Loc	Obs_ClockFrom	Obs_ClockTo	Observation	Obs_Remarks
0			Start of Survey	
0			Manhole	S07MM1036MH
0			Water Level	
4	07	04	Roots Fine Joint	
13.80000019	07	05	Deposits Attached Encrustation	
19.89999962	07	04	Roots Fine Joint	
68.30000305	03	10	Roots Fine Joint	
76.80000305	07	05	Deposits Attached Encrustation	
76.80000305			Manhole	S07MM1036MH
76.80000305			End of Survey	
76.80000305			Dye Test Visible	IN MH 036,FROM DROP LINE

City of Baltimore Wet Smoke and Dyed	Page 2 of 2	
Sewershed: Gwynns Falls	Company: Savin	Date: 4/22/2009
Test to be performed:  Smoke Dyed Water X	Ground Condition:  Dry ✓ Damp □ Wet □	Supervisor: JAW
Manhole_ID: S07MM1036MH	Test ID: <u>D1032-034012</u>	Notification Made: NA (Residents, Fire, 311)